

ARDEX S16 GREY AND WHITE

Chemwatch Material Safety Data Sheet
Issue Date: 6-Dec-2007

Revision No: 3

Hazard Alert Code:
HIGH

Chemwatch 4712-50
CD 2008/2

Section 1 - CHEMICAL PRODUCT AND COMPANY IDENTIFICATION

PRODUCT NAME: ARDEX S16 GREY AND WHITE

SYNONYMS

"2-part cementitious fast setting tile adhesive", "2-part cementitious fast setting tile adhesive"

PRODUCT USE

Cementitious fast setting adhesive for fixing tiles and stones.

SUPPLIER

Company: Ardex Australia Pty Ltd

Address:

20 Powers Road

Seven Hills


NSW, 2147

AUS

Telephone: 1800 224 070

Fax: +61 2 9838 7817

HAZARD RATINGS

	Min	Max	
Flammability:	0	0	 <p>Min/Nil=0 Low=1 Moderate=2 High=3 Extreme=4</p>
Toxicity:	2	2	
Body Contact:	3	3	
Reactivity:	0	0	
Chronic:	3	3	

Section 2 - HAZARDS IDENTIFICATION**STATEMENT OF HAZARDOUS NATURE**

HAZARDOUS SUBSTANCE. NON-DA NGEROUS GOODS. According to the Criteria of NOHSC, and the ADG Code.

POISONS SCHEDULE

None

RISK

Causes burns.

Risk of serious damage to eyes.

Harmful: danger of serious damage to health by prolonged exposure through inhalation.

Inhalation may produce health damage*.

Cumulative effects may result following exposure*.

Possible respiratory sensitiser*.

Possible skin sensitiser*.

Possible cancer-causing agent following repeated inhalation*.

* (limited evidence).

SAFETY

Keep locked up.

Use only in well ventilated areas.

Keep container in a well ventilated place.

Avoid exposure - obtain special instructions before use.

To clean the floor and all objects contaminated by this material use water and detergent.

Take off immediately all contaminated clothing.

In case of accident or if you feel unwell IMMEDIATELY contact Doctor or Poisons Information Centre (show label if possible).

Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

NAME	CAS RN	%
portland cement	65997-15-1	30-60
silica crystalline - quartz	14808-60-7	30-60
calcium carbonate	471-34-1	10-30
ethylene/ vinyl acetate copolymer	24937-78-8	Not spec

Section 4 - FIRST AID MEASURES**SWALLOWED**

- For advice, contact a Poisons Information Centre or a doctor at once.
- Urgent hospital treatment is likely to be needed.
- If swallowed do NOT induce vomiting.
- If vomiting occurs, lean patient forward or place on left side (head-down position, if possible) to maintain open airway and prevent aspiration.
- Observe the patient carefully.
- Never give liquid to a person showing signs of being sleepy or with reduced awareness; i.e. becoming unconscious.

ARDEX S16 GREY AND WHITE

Chemwatch Material Safety Data Sheet

Revision No: 3

Hazard Alert Code:
HIGH

Chemwatch 4712-50

Issue Date: 6-Dec-2007

CD 2008/2

- Give water to rinse out mouth, then provide liquid slowly and as much as casualty can comfortably drink.
- Transport to hospital or doctor without delay.

EYE

If this product comes in contact with the eyes:

- Immediately hold eyelids apart and flush the eye continuously with running water.
- Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.
- Continue flushing until advised to stop by the Poisons Information Centre or a doctor, or for at least 15 minutes.
- Transport to hospital or doctor without delay.
- Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

SKIN

If skin or hair contact occurs:

- Immediately flush body and clothes with large amounts of water, using safety shower if available.
- Quickly remove all contaminated clothing, including footwear.
- Wash skin and hair with running water. Continue flushing with water until advised to stop by the Poisons Information Centre.
- Transport to hospital, or doctor.

INHALED

- If fumes or combustion products are inhaled remove from contaminated area.
- Lay patient down. Keep warm and rested.
- Prostheses such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures.
- Apply artificial respiration if not breathing, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary.
- Transport to hospital, or doctor, without delay.

NOTES TO PHYSICIAN

Treat symptomatically.

For acute or short-term repeated exposures to highly alkaline materials:

- Respiratory stress is uncommon but present occasionally because of soft tissue edema.
- Unless endotracheal intubation can be accomplished under direct vision, cricothyroidotomy or tracheotomy may be necessary.
- Oxygen is given as indicated.
- The presence of shock suggests perforation and mandates an intravenous line and fluid administration.
- Damage due to alkaline corrosives occurs by liquefaction necrosis whereby the saponification of fats and solubilisation of proteins allow deep penetration into the tissue.

Alkalis continue to cause damage after exposure.

INGESTION:

- Milk and water are the preferred diluents

No more than 2 glasses of water should be given to an adult.

- Neutralising agents should never be given since exothermic heat reaction may compound injury.

* Catharsis and emesis are absolutely contra-indicated.

* Activated charcoal does not absorb alkali.

* Gastric lavage should not be used.

Supportive care involves the following:

- Withhold oral feedings initially.
- If endoscopy confirms transmucosal injury start steroids only within the first 48 hours.
- Carefully evaluate the amount of tissue necrosis before assessing the need for surgical intervention.
- Patients should be instructed to seek medical attention whenever they develop difficulty in swallowing (dysphagia).

SKIN AND EYE:

- Injury should be irrigated for 20-30 minutes.

Eye injuries require saline. [Ellenhorn & Barceloux: Medical Toxicology].

Section 5 - FIRE FIGHTING MEASURES**EXTINGUISHING MEDIA**

- There is no restriction on the type of extinguisher which may be used.
- Use extinguishing media suitable for surrounding area.

FIRE FIGHTING

- Alert Fire Brigade and tell them location and nature of hazard.
- Wear breathing apparatus plus protective gloves for fire only.
- Prevent, by any means available, spillage from entering drains or water courses.
- Use fire fighting procedures suitable for surrounding area.
- DO NOT approach containers suspected to be hot.
- Cool fire exposed containers with water spray from a protected location.
- If safe to do so, remove containers from path of fire.
- Equipment should be thoroughly decontaminated after use.

FIRE/EXPLOSION HAZARD

- Non combustible.
- Not considered a significant fire risk, however containers may burn.

Decomposition may produce toxic fumes of: metal oxides.

May emit poisonous fumes.

May emit corrosive fumes.

FIRE INCOMPATIBILITY

None known.

HAZCHEM

None

ARDEX S16 GREY AND WHITE

Chemwatch Material Safety Data Sheet
Issue Date: 6-Dec-2007

Revision No: 3

Hazard Alert Code:
HIGH
Chemwatch 4712-50
CD 2008/2

Personal Protective Equipment

Gas tight chemical resistant suit.

Section 6 - ACCIDENTAL RELEASE MEASURES**EMERGENCY PROCEDURES****MINOR SPILLS**

- Remove all ignition sources.
- Clean up all spills immediately.
- Avoid contact with skin and eyes.
- Control personal contact by using protective equipment.
- Use dry clean up procedures and avoid generating dust.
- Place in a suitable labelled container for waste disposal.

MAJOR SPILLS

Moderate hazard.

- CAUTION: Advise personnel in area.
- Alert Emergency Services and tell them location and nature of hazard.
- Control personal contact by wearing protective clothing.
- Prevent, by any means available, spillage from entering drains or water courses.
- Recover product wherever possible.
- IF DRY: Use dry clean up procedures and avoid generating dust. Collect residues and place in sealed plastic bags or other containers for disposal. IF WET: Vacuum/shovel up and place in labelled containers for disposal.
- ALWAYS: Wash area down with large amounts of water and prevent runoff into drains.
- If contamination of drains or waterways occurs, advise Emergency Services.

SAFE STORAGE WITH OTHER CLASSIFIED CHEMICALS

+

+

+

+

X

+

X: Must not be stored together

O: May be stored together with specific preventions

+: May be stored together

Personal Protective Equipment advice is contained in Section 8 of the MSDS.

Section 7 - HANDLING AND STORAGE**PROCEDURE FOR HANDLING**

- Avoid all personal contact, including inhalation.
- Wear protective clothing when risk of exposure occurs.
- Use in a well-ventilated area.
- Prevent concentration in hollows and sumps.
- DO NOT enter confined spaces until atmosphere has been checked.
- DO NOT allow material to contact humans, exposed food or food utensils.
- Avoid contact with incompatible materials.
- When handling, DO NOT eat, drink or smoke.
- Keep containers securely sealed when not in use.
- Avoid physical damage to containers.
- Always wash hands with soap and water after handling.
- Work clothes should be laundered separately. Launder contaminated clothing before re-use.
- Use good occupational work practice.
- Observe manufacturer's storing and handling recommendations.
- Atmosphere should be regularly checked against established exposure standards to ensure safe working conditions are maintained.

SUITABLE CONTAINER

- Polyethylene or polypropylene container.
- Check all containers are clearly labelled and free from leaks.

STORAGE INCOMPATIBILITY

None known.

STORAGE REQUIREMENTS

- Store in original containers.
- Keep containers securely sealed.
- Store in a cool, dry area protected from environmental extremes.
- Store away from incompatible materials and foodstuff containers.
- Protect containers against physical damage and check regularly for leaks.
- Observe manufacturer's storing and handling recommendations
- Consider storage in bunded areas - ensure storage areas are isolated from sources of community water (including stormwater, ground water, lakes and streams).

ARDEX S16 GREY AND WHITEHazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet

Revision No: 3

Chemwatch 4712-50

Issue Date: 6-Dec-2007

CD 2008/2

- Ensure that accidental discharge to air or water is the subject of a contingency disaster management plan; this may require consultation with local authorities.

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION**EXPOSURE CONTROLS**

Source	Material	TWA ppm	TWA mg/m ³	STEL ppm	STEL mg/m ³	Peak ppm	Peak mg/m ³	TWA F/CC
Australia Exposure Standards	portland cement (Portland cement (a))		10					
Australia Exposure Standards	silica crystalline - quartz (Silica - Crystalline Quartz)		0.1					
Australia Exposure Standards	silica crystalline - quartz (Silica - Amorphous Fume (thermally generated))(respirable dust) (g))		2					
Australia Exposure Standards	calcium carbonate (Calcium carbonate (a))		10					

The following materials had no OELs on our records

- ethylene/ vinyl acetate copolymer: CAS:24937-78-8

EMERGENCY EXPOSURE LIMITS

Material	Revised IDLH Value (mg/m ³)	Revised IDLH Value (ppm)
portland cement	5,000	
silica crystalline - quartz	50	

MATERIAL DATA

Not available. Refer to individual constituents.

INGREDIENT DATA

CALCIUM CARBONATE:

PORTLAND CEMENT:

Sensory irritants are chemicals that produce temporary and undesirable side-effects on the eyes, nose or throat. Historically occupational exposure standards for these irritants have been based on observation of workers' responses to various airborne concentrations. Present day expectations require that nearly every individual should be protected against even minor sensory irritation and exposure standards are established using uncertainty factors or safety factors of 5 to 10 or more. On occasion animal no-observable-effect-levels (NOEL) are used to determine these limits where human results are unavailable. An additional approach, typically used by the TLV committee (USA) in determining respiratory standards for this group of chemicals, has been to assign ceiling values (TLV C) to rapidly acting irritants and to assign short-term exposure limits (TLV STELs) when the weight of evidence from irritation, bioaccumulation and other endpoints combine to warrant such a limit. In contrast the MAK Commission (Germany) uses a five-category system based on intensive odour, local irritation, and elimination half-life. However this system is being replaced to be consistent with the European Union (EU) Scientific Committee for Occupational Exposure Limits (SCOEL); this is more closely allied to that of the USA.

OSHA (USA) concluded that exposure to sensory irritants can:

- cause inflammation
- cause increased susceptibility to other irritants and infectious agents
- lead to permanent injury or dysfunction
- permit greater absorption of hazardous substances and
- acclimate the worker to the irritant warning properties of these substances thus increasing the risk of overexposure.

PORTLAND CEMENT:

Portland cement is considered to be a nuisance dust that does not cause fibrosis and has little potential to induce adverse effects on the lung.

SILICA CRYSTALLINE - QUARTZ:

Because the margin of safety of the quartz TLV is not known with certainty and given the associated link between silicosis and lung cancer it is recommended that quartz concentrations be maintained as far below the TLV as prudent practices will allow.

CALCIUM CARBONATE:

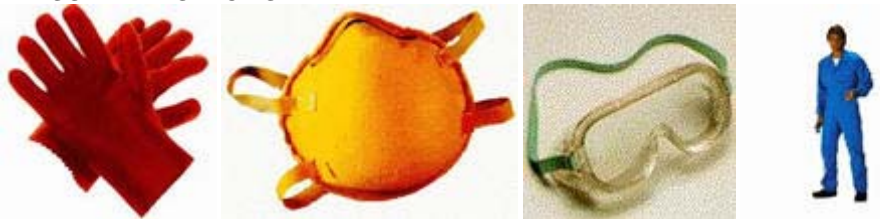
The TLV-TWA is thought to be protective against the significant risk of physical irritation associated with exposure.

ETHYLENE/ VINYL ACETATE COPOLYMER:

Particulates Not Otherwise Classified (PNOC)

TLV TWA: 10 mg/m³ Inhalable particulate

TLV TWA: 3 mg/m³ Respirable particulate.

PERSONAL PROTECTION**EYE**

- Chemical goggles.
- Full face shield may be required for supplementary but never for primary protection of eyes
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lens or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure,

ARDEX S16 GREY AND WHITEHazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet

Revision No: 3

Chemwatch 4712-50

Issue Date: 6-Dec-2007

CD 2008/2

begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59]

HANDS/FEET

- Wear chemical protective gloves, eg. PVC.
- Wear safety footwear or safety gumboots, eg. Rubber

NOTE:

- The material may produce skin sensitisation in predisposed individuals. Care must be taken, when removing gloves and other protective equipment, to avoid all possible skin contact.
- Contaminated leather items, such as shoes, belts and watch-bands should be removed and destroyed.

OTHER

- Overalls.
- P.V.C. apron.
- Barrier cream.
- Skin cleansing cream.
- Eye wash unit.

RESPIRATOR

Protection Factor	Half-Face Respirator	Full-Face Respirator	Powered Air Respirator
10 x ES	P1 Air-line*	- -	PAPR-P1 -
50 x ES	Air-line**	P2	PAPR-P2
100 x ES	-	P3	-
		Air-line*	-
100+ x ES	-	Air-line**	PAPR-P3

* - Negative pressure demand ** - Continuous flow.

The local concentration of material, quantity and conditions of use determine the type of personal protective equipment required. For further information consult site specific CHEMWATCH data (if available), or your Occupational Health and Safety Advisor.

ENGINEERING CONTROLS

Local exhaust ventilation usually required. If risk of overexposure exists, wear approved respirator. Correct fit is essential to obtain adequate protection. Supplied-air type respirator may be required in special circumstances. Correct fit is essential to ensure adequate protection.

An approved self contained breathing apparatus (SCBA) may be required in some situations.

Provide adequate ventilation in warehouse or closed storage area. Air contaminants generated in the workplace possess varying "escape" velocities which, in turn, determine the "capture velocities" of fresh circulating air required to effectively remove the contaminant.

Type of Contaminant:	Air Speed:
solvent, vapours, degreasing etc., evaporating from tank (in still air).	0.25-0.5 m/s (50-100 f/min.)
aerosols, fumes from pouring operations, intermittent container filling, low speed conveyer transfers, welding, spray drift, plating acid fumes, pickling (released at low velocity into zone of active generation)	0.5-1 m/s (100-200 f/min.)
direct spray, spray painting in shallow booths, drum filling, conveyer loading, crusher dusts, gas discharge (active generation into zone of rapid air motion)	1-2.5 m/s (200-500 f/min.)
grinding, abrasive blasting, tumbling, high speed wheel generated dusts (released at high initial velocity into zone of very high rapid air motion).	2.5-10 m/s (500-2000 f/min.)

Within each range the appropriate value depends on:

Lower end of the range	Upper end of the range
1: Room air currents minimal or favourable to capture	1: Disturbing room air currents
2: Contaminants of low toxicity or of nuisance value only.	2: Contaminants of high toxicity
3: Intermittent, low production.	3: High production, heavy use
4: Large hood or large air mass in motion	4: Small hood-local control only

Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple extraction pipe. Velocity generally decreases with the square of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point should be adjusted, accordingly, after reference to distance from the contaminating source. The air velocity at the extraction fan, for example, should be a minimum of 1-2 m/s (200-400 f/min) for extraction of solvents generated in a tank 2 meters distant from the extraction point. Other mechanical considerations, producing performance deficits within the extraction apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more when extraction systems are installed or used.

Section 9 - PHYSICAL AND CHEMICAL PROPERTIES**APPEARANCE**

Coloured powder with a characteristic odour; mixes slightly with water.

PHYSICAL PROPERTIES

Does not mix with water.

Sinks in water.

Alkaline.

Molecular Weight: Not Applicable

Boiling Range (°C): Not Available

Melting Range (°C): Not Available

Specific Gravity (water=1): 1.1-1.7

ARDEX S16 GREY AND WHITEHazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet

Revision No: 3

Chemwatch 4712-50

Issue Date: 6-Dec-2007

CD 2008/2

Solubility in water (g/L): Immiscible
 pH (1% solution): 11 approx.
 Volatile Component (%vol): Not Applicable
 Relative Vapour Density (air=1): Not Applicable
 Lower Explosive Limit (%): Not Applicable
 Autoignition Temp (°C): Not Available
 State: Divided Solid

pH (as supplied): Not Available
 Vapour Pressure (kPa): Not Applicable
 Evaporation Rate: Not Applicable
 Flash Point (°C): Not Applicable
 Upper Explosive Limit (%): Not Applicable
 Decomposition Temp (°C): Not Available
 Viscosity: Not available

Section 10 - CHEMICAL STABILITY AND REACTIVITY INFORMATION**CONDITIONS CONTRIBUTING TO INSTABILITY**

- Presence of incompatible materials.
- Product is considered stable.
- Hazardous polymerisation will not occur.

Section 11 - TOXICOLOGICAL INFORMATION**POTENTIAL HEALTH EFFECTS****ACUTE HEALTH EFFECTS****SWALLOWED**

The material can produce chemical burns within the oral cavity and gastrointestinal tract following ingestion.

The material has NOT been classified by EC Directives or other classification systems as "harmful by ingestion". This is because of the lack of corroborating animal or human evidence. The material may still be damaging to the health of the individual, following ingestion, especially where pre-existing organ (eg. liver, kidney) damage is evident. Present definitions of harmful or toxic substances are generally based on doses producing mortality rather than those producing morbidity (disease, ill-health). Gastrointestinal tract discomfort may produce nausea and vomiting. In an occupational setting however, ingestion of insignificant quantities is not thought to be cause for concern.

EYE

The material can produce chemical burns to the eye following direct contact. Vapours or mists may be extremely irritating.

If applied to the eyes, this material causes severe eye damage.

The material may produce severe irritation to the eye causing pronounced inflammation. Repeated or prolonged exposure to irritants may produce conjunctivitis.

SKIN

The material can produce chemical burns following direct contact with the skin.

Skin contact is not thought to have harmful health effects (as classified under EC Directives); the material may still produce health damage following entry through wounds, lesions or abrasions.

Entry into the blood-stream, through, for example, cuts, abrasions or lesions, may produce systemic injury with harmful effects. Examine the skin prior to the use of the material and ensure that any external damage is suitably protected.

The material may cause skin irritation after prolonged or repeated exposure and may produce on contact skin redness, swelling, the production of vesicles, scaling and thickening of the skin.

INHALED

Inhalation of dusts, generated by the material during the course of normal handling, may be damaging to the health of the individual.

The material can cause respiratory irritation in some persons. The body's response to such irritation can cause further lung damage.

Effects on lungs are significantly enhanced in the presence of respirable particles.

Acute silicosis occurs under conditions of extremely high silica dust exposure particularly when the particle size of the dust is small. The disease is rapidly progressive and spreads widely through the lungs within months of the initial exposure and causing death within 1 to 2 years.

CHRONIC HEALTH EFFECTS

Harmful: danger of serious damage to health by prolonged exposure through inhalation.

TOXICITY AND IRRITATION

None assigned. Refer to individual constituents.

PORTLAND CEMENT:

unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.

Asthma-like symptoms may continue for months or even years after exposure to the material ceases. This may be due to a non-allergenic condition known as reactive airways dysfunction syndrome (RADS) which can occur following exposure to high levels of highly irritating compound. Key criteria for the diagnosis of RADS include the absence of preceding respiratory disease, in a non-atopic individual, with abrupt onset of persistent asthma-like symptoms within minutes to hours of a documented exposure to the irritant. A reversible airflow pattern, on spirometry, with the presence of moderate to severe bronchial hyperreactivity on methacholine challenge testing and the lack of minimal lymphocytic inflammation, without eosinophilia, have also been included in the criteria for diagnosis of RADS. RADS (or asthma) following an irritating inhalation is an infrequent disorder with rates related to the concentration of and duration of exposure to the irritating substance. Industrial bronchitis, on the other hand, is a disorder that occurs as result of exposure due to high concentrations of irritating substance (often particulate in nature) and is completely reversible after exposure ceases. The disorder is characterised by dyspnea, cough and mucus production.

SILICA CRYSTALLINE - QUARTZ:

unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.

TOXICITY

Inhalation (human) LCLo: 0.3 mg/m³/10Y

Inhalation (human) TCLo: 16 mppcf*/8H/17.9Y

Inhalation (rat) TCLo: 50 mg/m³/6H/71W

IRRITATION

Nil Reported

WARNING: For inhalation exposure ONLY: This substance has been classified by the IARC as Group 1: CARCINOGENIC TO

ARDEX S16 GREY AND WHITEHazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet

Revision No: 3

Chemwatch 4712-50

Issue Date: 6-Dec-2007

CD 2008/2

HUMANS.

Intermittent; focal fibrosis,
(pneumoconiosis), cough, dyspnoea
Intermittent; liver - tumours.

* Millions of particles per cubic foot (based on impinger samples counted
by light field techniques).

NOTE : the physical nature of quartz in the product determines whether
it is likely to present a chronic health problem. To be a hazard
the material must enter the breathing zone as respirable particles.

CALCIUM CARBONATE:

unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.

Oral (Rat) LD50: 6450 mg/kg

Skin (rabbit): 500 mg/24h-Moderate

Eye (rabbit): 0.75 mg/24h - SEVERE

The material may produce severe irritation to the eye causing pronounced inflammation. Repeated or prolonged exposure to irritants may produce conjunctivitis.

The material may cause skin irritation after prolonged or repeated exposure and may produce on contact skin redness, swelling, the production of vesicles, scaling and thickening of the skin.

No evidence of carcinogenic properties.

No evidence of mutagenic or

teratogenic effects.

ETHYLENE/ VINYL ACETATE COPOLYMER:

unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.

Not available for mixture or identified for ingredient(s).

MATERIAL	CARCINOGEN	REPROTOXIN	SENSITISER	SKIN
----------	------------	------------	------------	------

silica crystalline - quartz	IARC:1			
-----------------------------	--------	--	--	--

CARCINOGEN

IARC: International Agency for Research on Cancer (IARC) Carcinogens: silica
crystalline - quartz Category: WARNING: This substance has been classified by the IARC
as Group 1: CARCINOGENIC TO HUMANS.

Section 12 - ECOLOGICAL INFORMATION

DO NOT discharge into sewer or waterways.

Refer to data for ingredients, which follows:

PORTLAND CEMENT:

DO NOT discharge into sewer or waterways.

SILICA CRYSTALLINE - QUARTZ:

DO NOT discharge into sewer or waterways.

Section 13 - DISPOSAL CONSIDERATIONS

- Recycle wherever possible.
- Consult manufacturer for recycling options or consult local or regional waste management authority for disposal if no suitable treatment or disposal facility can be identified.
- Dispose of by: Burial in a licenced land-fill or Incineration in a licenced apparatus (after admixture with suitable combustible material)
- Decontaminate empty containers. Observe all label safeguards until containers are cleaned and destroyed.
- Containers may still present a chemical hazard/ danger when empty.
- Return to supplier for reuse/ recycling if possible.

Otherwise:

- If container can not be cleaned sufficiently well to ensure that residuals do not remain or if the container cannot be used to store the same product, then puncture containers, to prevent re-use, and bury at an authorised landfill.
- Where possible retain label warnings and MSDS and observe all notices pertaining to the product.

Section 14 - TRANSPORTATION INFORMATION

Labels Required:

HAZCHEM: None

NOT REGULATED FOR TRANSPORT OF DANGEROUS GOODS:UN, IATA,

IMDG

Section 15 - REGULATORY INFORMATION**POISONS SCHEDULE**

None

REGULATIONS

Ardex S16 Grey And White (CAS: None):

No regulations applicable

portland cement (CAS: 65997- 15- 1) is found on the following regulatory lists;

Australia Exposure Standards

ARDEX S16 GREY AND WHITEHazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet

Revision No: 3

Chemwatch 4712-50

Issue Date: 6-Dec-2007

CD 2008/2

Australia High Volume Industrial Chemical List (HVICL)
 Australia Inventory of Chemical Substances (AICS)
 OECD Representative List of High Production Volume (HPV) Chemicals
 silica crystalline - quartz (CAS: 14808- 60- 7) is found on the following regulatory lists;
 Australia - New South Wales Hazardous Substances Prohibited for Specific Uses
 Australia - New South Wales Hazardous Substances Requiring Health Surveillance
 Australia - South Australia Hazardous Substances Requiring Health Surveillance
 Australia - Tasmania Hazardous Substances Prohibited for Specified Uses
 Australia - Tasmania Hazardous Substances Requiring Health Surveillance
 Australia - Western Australia Hazardous Substances Requiring Health Surveillance
 Australia Exposure Standards
 Australia Hazardous Substances
 Australia Hazardous Substances Requiring Health Surveillance
 Australia High Volume Industrial Chemical List (HVICL)
 Australia Inventory of Chemical Substances (AICS)
 Australia Occupational Health and Safety (Commonwealth Employment) (National Standards) Regulations 1994 - Hazardous Substances Requiring Health Surveillance
 Australia Standard for the Uniform Scheduling of Drugs and Poisons (SUSDP) - Schedule 6
 International Agency for Research on Cancer (IARC) Carcinogens
 OECD Representative List of High Production Volume (HPV) Chemicals
 calcium carbonate (CAS: 471- 34- 1) is found on the following regulatory lists;
 Australia High Volume Industrial Chemical List (HVICL)
 Australia Inventory of Chemical Substances (AICS)
 Australia Therapeutic Goods Administration (TGA) Substances that may be used as active ingredients in Listed medicines
 CODEX General Standard for Food Additives (GSFA) - Additives Permitted for Use in Food in General, Unless Otherwise Specified, in Accordance with GMP
 GESAMP/EHS Composite List of Hazard Profiles - Hazard evaluation of substances transported by ships
 IMO IBC Code Chapter 17: Summary of minimum requirements
 International Council of Chemical Associations (ICCA) - High Production Volume List
 OECD Representative List of High Production Volume (HPV) Chemicals
 calcium carbonate (CAS: 1317- 65- 3) is found on the following regulatory lists;
 Australia Exposure Standards
 Australia Inventory of Chemical Substances (AICS)
 Australia Standard for the Uniform Scheduling of Drugs and Poisons (SUSDP) - Schedule 6
 OECD Representative List of High Production Volume (HPV) Chemicals
 ethylene/ vinyl acetate copolymer (CAS: 24937- 78- 8) is found on the following regulatory lists;
 Australia Inventory of Chemical Substances (AICS)
 GESAMP/EHS Composite List of Hazard Profiles - Hazard evaluation of substances transported by ships
 IMO MARPOL 73/78 (Annex II) - List of Other Liquid Substances
 IMO Provisional Categorization of Liquid Substances - List 1: Pure or technically pure products
 OECD Representative List of High Production Volume (HPV) Chemicals
 No data available for silica crystalline - quartz as CAS: 122304- 48- 7, CAS: 122304- 49- 8, CAS: 12425- 26- 2, CAS: 1317- 79- 9, CAS: 70594- 95- 5, CAS: 87347- 84- 0.
 No data available for calcium carbonate as CAS: 13397- 26- 7, CAS: 15634- 14- 7.

Section 16 - OTHER INFORMATION**Ingredients with multiple CAS Nos**

Ingredient Name	CAS
silica crystalline - quartz	14808-60-7, 122304-48-7, 122304-49-8, 12425-26-2, 1317-79-9, 70594-95-5, 87347-84-0
calcium carbonate	471-34-1, 13397-26-7, 15634-14-7, 1317-65-3

Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using available literature references.

A list of reference resources used to assist the committee may be found at:
www.chemwatch.net/references.

The (M)SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings. Risks may be determined by reference to Exposures Scenarios. Scale of use, frequency of use and current or available engineering controls must be considered.

This document is copyright. Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without written permission from CHEMWATCH. TEL (+61 3) 9572 4700.

Issue Date: 6-Dec-2007

Print Date: 12-Aug-2008