

ARDEX STS8

Chemwatch Material Safety Data Sheet
Issue Date: 30-May-2008

Revision No: 3

Hazard Alert Code:
HIGH

Chemwatch 4963-56
CD 2008/2

Section 1 - CHEMICAL PRODUCT AND COMPANY IDENTIFICATION

PRODUCT NAME: ARDEX STS8

SYNONYMS

"cement-based adhesive"

PRODUCT USE

Cementitious based adhesive.

SUPPLIER

Company: Ardex Australia Pty Ltd

Address:

20 Powers Road

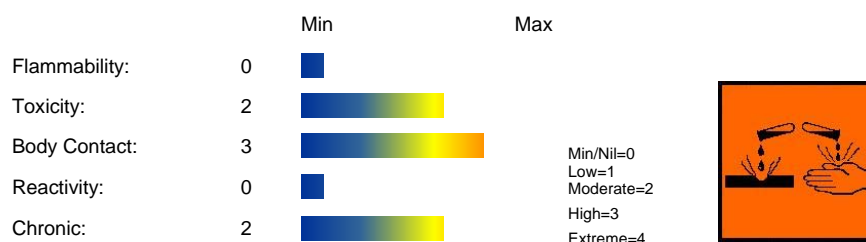
Seven Hills

NSW, 2147

AUS

Telephone: 1800 224 070

Fax: +61 2 9838 7817

HAZARD RATINGS**Section 2 - HAZARDS IDENTIFICATION****STATEMENT OF HAZARDOUS NATURE**

HAZARDOUS SUBSTANCE. NON-DANGEROUS GOODS. According to the Criteria of NOHSC, and the ADG Code.

POISONS SCHEDULE

None

RISK

Causes burns.

Risk of serious damage to eyes.

Harmful: danger of serious damage to health by prolonged exposure through inhalation.

Inhalation may produce health damage*.

Cumulative effects may result following exposure*.

Possible respiratory sensitiser*.

Possible skin sensitiser*.

* (limited evidence).

SAFETY

Keep locked up.

Do not breathe dust.

Avoid contact with eyes.

Wear suitable protective clothing.

Use only in well ventilated areas.

Keep container in a well ventilated place.

To clean the floor and all objects contaminated by this material use water and detergent.

Take off immediately all contaminated clothing.

In case of accident or if you feel unwell IMMEDIATELY contact Doctor or Poisons Information Centre (show label if possible).

Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

NAME	CAS RN	%
portland cement	65997-15-1	20-70
silica crystalline - quartz	14808-60-7	20-70
additives, unspecified		1-10

Section 4 - FIRST AID MEASURES**SWALLOWED**

- For advice, contact a Poisons Information Centre or a doctor at once.
- Urgent hospital treatment is likely to be needed.
- If swallowed do NOT induce vomiting.
- If vomiting occurs, lean patient forward or place on left side (head-down position, if possible) to maintain open airway and prevent aspiration.
- Observe the patient carefully.
- Never give liquid to a person showing signs of being sleepy or with reduced awareness; i.e. becoming unconscious.
- Give water to rinse out mouth, then provide liquid slowly and as much as casualty can comfortably drink.
- Transport to hospital or doctor without delay.

ARDEX STS8

Chemwatch Material Safety Data Sheet
Issue Date: 30-May-2008

Revision No: 3

Hazard Alert Code:
HIGH
Chemwatch 4963-56
CD 2008/2

EYE

If this product comes in contact with the eyes:

- Immediately hold eyelids apart and flush the eye continuously with running water.
- Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.
- Continue flushing until advised to stop by the Poisons Information Centre or a doctor, or for at least 15 minutes.
- Transport to hospital or doctor without delay.
- Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

SKIN

If skin or hair contact occurs:

- Immediately flush body and clothes with large amounts of water, using safety shower if available.
- Quickly remove all contaminated clothing, including footwear.
- Wash skin and hair with running water. Continue flushing with water until advised to stop by the Poisons Information Centre.
- Transport to hospital, or doctor.

INHALED

- If fumes or combustion products are inhaled remove from contaminated area.
- Lay patient down. Keep warm and rested.
- Prostheses such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures.
- Apply artificial respiration if not breathing, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary.
- Transport to hospital, or doctor, without delay.

NOTES TO PHYSICIAN

Treat symptomatically.

For acute or short-term repeated exposures to highly alkaline materials:

- Respiratory stress is uncommon but present occasionally because of soft tissue edema.
- Unless endotracheal intubation can be accomplished under direct vision, cricothyroidotomy or tracheotomy may be necessary.
- Oxygen is given as indicated.
- The presence of shock suggests perforation and mandates an intravenous line and fluid administration.
- Damage due to alkaline corrosives occurs by liquefaction necrosis whereby the saponification of fats and solubilisation of proteins allow deep penetration into the tissue.

Alkalis continue to cause damage after exposure.

INGESTION:

- Milk and water are the preferred diluents

No more than 2 glasses of water should be given to an adult.

- Neutralising agents should never be given since exothermic heat reaction may compound injury.

* Catharsis and emesis are absolutely contra-indicated.

* Activated charcoal does not absorb alkali.

* Gastric lavage should not be used.

Supportive care involves the following:

- Withhold oral feedings initially.
- If endoscopy confirms transmucosal injury start steroids only within the first 48 hours.
- Carefully evaluate the amount of tissue necrosis before assessing the need for surgical intervention.
- Patients should be instructed to seek medical attention whenever they develop difficulty in swallowing (dysphagia).

SKIN AND EYE:

- Injury should be irrigated for 20-30 minutes.

Eye injuries require saline. [Ellenhorn & Barceloux: Medical Toxicology].

Section 5 - FIRE FIGHTING MEASURES**EXTINGUISHING MEDIA**

- There is no restriction on the type of extinguisher which may be used.
- Use extinguishing media suitable for surrounding area.

FIRE FIGHTING

- Alert Fire Brigade and tell them location and nature of hazard.
- Wear breathing apparatus plus protective gloves for fire only.
- Prevent, by any means available, spillage from entering drains or water courses.
- Use fire fighting procedures suitable for surrounding area.
- DO NOT approach containers suspected to be hot.
- Cool fire exposed containers with water spray from a protected location.
- If safe to do so, remove containers from path of fire.
- Equipment should be thoroughly decontaminated after use.

FIRE/EXPLOSION HAZARD

- Non combustible.
- Not considered a significant fire risk, however containers may burn.

Decomposition may produce toxic fumes of: metal oxides.

May emit corrosive fumes.

FIRE INCOMPATIBILITY

None known.

HAZCHEM

None

Personal Protective Equipment

Gas tight chemical resistant suit.

ARDEX STS8

Chemwatch Material Safety Data Sheet
Issue Date: 30-May-2008

Revision No: 3

Hazard Alert Code:
HIGH
Chemwatch 4963-56
CD 2008/2

Section 6 - ACCIDENTAL RELEASE MEASURES**EMERGENCY PROCEDURES****MINOR SPILLS**

- Remove all ignition sources.
- Clean up all spills immediately.
- Avoid contact with skin and eyes.
- Control personal contact by using protective equipment.
- Use dry clean up procedures and avoid generating dust.
- Place in a suitable labelled container for waste disposal.

MAJOR SPILLS

Moderate hazard.

- CAUTION: Advise personnel in area.
- Alert Emergency Services and tell them location and nature of hazard.
- Control personal contact by wearing protective clothing.
- Prevent, by any means available, spillage from entering drains or water courses.
- Recover product wherever possible.
- IF DRY: Use dry clean up procedures and avoid generating dust. Collect residues and place in sealed plastic bags or other containers for disposal. IF WET: Vacuum/shovel up and place in labelled containers for disposal.
- ALWAYS: Wash area down with large amounts of water and prevent runoff into drains.
- If contamination of drains or waterways occurs, advise Emergency Services.

SAFE STORAGE WITH OTHER CLASSIFIED CHEMICALS

X: Must not be stored together

O: May be stored together with specific preventions

+: May be stored together

Personal Protective Equipment advice is contained in Section 8 of the MSDS.

Section 7 - HANDLING AND STORAGE**PROCEDURE FOR HANDLING**

- Avoid all personal contact, including inhalation.
- Wear protective clothing when risk of exposure occurs.
- Use in a well-ventilated area.
- Prevent concentration in hollows and sumps.
- DO NOT enter confined spaces until atmosphere has been checked.
- DO NOT allow material to contact humans, exposed food or food utensils.
- Avoid contact with incompatible materials.
- When handling, DO NOT eat, drink or smoke.
- Keep containers securely sealed when not in use.
- Avoid physical damage to containers.
- Always wash hands with soap and water after handling.
- Work clothes should be laundered separately. Launder contaminated clothing before re-use.
- Use good occupational work practice.
- Observe manufacturer's storing and handling recommendations.
- Atmosphere should be regularly checked against established exposure standards to ensure safe working conditions are maintained.

SUITABLE CONTAINER

- Polyethylene or polypropylene container.
- Check all containers are clearly labelled and free from leaks.

STORAGE INCOMPATIBILITY

None known.

STORAGE REQUIREMENTS

- Store in original containers.
- Keep containers securely sealed.
- Store in a cool, dry area protected from environmental extremes.
- Store away from incompatible materials and foodstuff containers.
- Protect containers against physical damage and check regularly for leaks.
- Observe manufacturer's storing and handling recommendations
- Consider storage in bunded areas - ensure storage areas are isolated from sources of community water (including stormwater, ground water, lakes and streams).
- Ensure that accidental discharge to air or water is the subject of a contingency disaster management plan; this may require consultation with local authorities.

ARDEX STS8Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet

Revision No: 3

Chemwatch 4963-56

Issue Date: 30-May-2008

CD 2008/2

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION**EXPOSURE CONTROLS**

Source	Material	TWA ppm	TWA mg/m ³	STEL ppm	STEL mg/m ³	Peak ppm	Peak mg/m ³	TWA F/CC
Australia Exposure Standards	portland cement (Portland cement (a))		10					
Australia Exposure Standards	silica crystalline - quartz (Silica - Crystalline Quartz)		0.1					
Australia Exposure Standards	silica crystalline - quartz (Silica - Amorphous Fume (thermally generated))(respirable dust) (g))		2					

EMERGENCY EXPOSURE LIMITS

Material	Revised IDLH Value (mg/m3)	Revised IDLH Value (ppm)
portland cement	5,000	
silica crystalline - quartz	50	

MATERIAL DATA

Not available. Refer to individual constituents.

INGREDIENT DATA**PORTLAND CEMENT:**

Sensory irritants are chemicals that produce temporary and undesirable side-effects on the eyes, nose or throat. Historically occupational exposure standards for these irritants have been based on observation of workers' responses to various airborne concentrations. Present day expectations require that nearly every individual should be protected against even minor sensory irritation and exposure standards are established using uncertainty factors or safety factors of 5 to 10 or more. On occasion animal no-observable-effect-levels (NOEL) are used to determine these limits where human results are unavailable. An additional approach, typically used by the TLV committee (USA) in determining respiratory standards for this group of chemicals, has been to assign ceiling values (TLV C) to rapidly acting irritants and to assign short-term exposure limits (TLV STELs) when the weight of evidence from irritation, bioaccumulation and other endpoints combine to warrant such a limit. In contrast the MAK Commission (Germany) uses a five-category system based on intensive odour, local irritation, and elimination half-life. However this system is being replaced to be consistent with the European Union (EU) Scientific Committee for Occupational Exposure Limits (SCOEL); this is more closely allied to that of the USA.

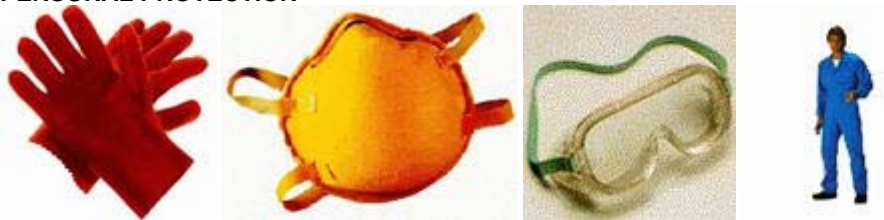
OSHA (USA) concluded that exposure to sensory irritants can:

- cause inflammation
- cause increased susceptibility to other irritants and infectious agents
- lead to permanent injury or dysfunction
- permit greater absorption of hazardous substances and
- acclimate the worker to the irritant warning properties of these substances thus increasing the risk of overexposure.

Portland cement is considered to be a nuisance dust that does not cause fibrosis and has little potential to induce adverse effects on the lung.

SILICA CRYSTALLINE - QUARTZ:

Because the margin of safety of the quartz TLV is not known with certainty and given the associated link between silicosis and lung cancer it is recommended that quartz concentrations be maintained as far below the TLV as prudent practices will allow.

PERSONAL PROTECTION**EYE**

- Chemical goggles.
- Full face shield may be required for supplementary but never for primary protection of eyes
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lens or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59]

HANDS/FEET

- Wear chemical protective gloves, eg. PVC.
- Wear safety footwear or safety gumboots, eg. Rubber

NOTE:

- The material may produce skin sensitisation in predisposed individuals. Care must be taken, when removing gloves and other protective equipment, to avoid all possible skin contact.
- Contaminated leather items, such as shoes, belts and watch-bands should be removed and destroyed.

OTHER

- Overalls.
- P.V.C. apron.
- Barrier cream.

ARDEX STS8Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet

Revision No: 3

Chemwatch 4963-56

Issue Date: 30-May-2008

CD 2008/2

- Skin cleansing cream.
- Eye wash unit.

RESPIRATOR

Protection Factor	Half-Face Respirator	Full-Face Respirator	Powered Air Respirator
10 x ES	P1 Air-line*	- -	PAPR-P1 -
50 x ES	Air-line**	P2	PAPR-P2
100 x ES	-	P3	-
		Air-line*	-
100+ x ES	-	Air-line**	PAPR-P3

* - Negative pressure demand ** - Continuous flow.

The local concentration of material, quantity and conditions of use determine the type of personal protective equipment required. For further information consult site specific CHEMWATCH data (if available), or your Occupational Health and Safety Advisor.

ENGINEERING CONTROLS

Local exhaust ventilation usually required. If risk of overexposure exists, wear approved respirator. Correct fit is essential to obtain adequate protection. Supplied-air type respirator may be required in special circumstances. Correct fit is essential to ensure adequate protection.

An approved self contained breathing apparatus (SCBA) may be required in some situations.

Provide adequate ventilation in warehouse or closed storage area. Air contaminants generated in the workplace possess varying "escape" velocities which, in turn, determine the "capture velocities" of fresh circulating air required to effectively remove the contaminant.

Type of Contaminant:	Air Speed:
solvent, vapours, degreasing etc., evaporating from tank (in still air).	0.25-0.5 m/s (50-100 f/min.)
aerosols, fumes from pouring operations, intermittent container filling, low speed conveyer transfers, welding, spray drift, plating acid fumes, pickling (released at low velocity into zone of active generation)	0.5-1 m/s (100-200 f/min.)
direct spray, spray painting in shallow booths, drum filling, conveyer loading, crusher dusts, gas discharge (active generation into zone of rapid air motion)	1-2.5 m/s (200-500 f/min.)
grinding, abrasive blasting, tumbling, high speed wheel generated dusts (released at high initial velocity into zone of very high rapid air motion).	2.5-10 m/s (500-2000 f/min.)

Within each range the appropriate value depends on:

Lower end of the range	Upper end of the range
1: Room air currents minimal or favourable to capture	1: Disturbing room air currents
2: Contaminants of low toxicity or of nuisance value only.	2: Contaminants of high toxicity
3: Intermittent, low production.	3: High production, heavy use
4: Large hood or large air mass in motion	4: Small hood-local control only

Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple extraction pipe. Velocity generally decreases with the square of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point should be adjusted, accordingly, after reference to distance from the contaminating source. The air velocity at the extraction fan, for example, should be a minimum of 1-2 m/s (200-400 f/min) for extraction of solvents generated in a tank 2 meters distant from the extraction point. Other mechanical considerations, producing performance deficits within the extraction apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more when extraction systems are installed or used.

Section 9 - PHYSICAL AND CHEMICAL PROPERTIES**APPEARANCE**

Fine grey powder; insoluble in water.

PHYSICAL PROPERTIES

Does not mix with water.

Sinks in water.

Alkaline.

Molecular Weight: Not Applicable

Melting Range (°C): Not Available

Solubility in water (g/L): Immiscible

pH (1% solution): Not Available

Volatile Component (%vol): Not Applicable

Relative Vapour Density (air=1): Not Applicable

Lower Explosive Limit (%): Not Applicable

Autoignition Temp (°C): Not Available

State: Divided Solid

Boiling Range (°C): >200

Specific Gravity (water=1): 1.1 approx.

pH (as supplied): Not Applicable

Vapour Pressure (kPa): Not Applicable

Evaporation Rate: Not Applicable

Flash Point (°C): Not Applicable

Upper Explosive Limit (%): Not Applicable

Decomposition Temp (°C): Not Available

Viscosity: Not Applicable

Section 10 - CHEMICAL STABILITY AND REACTIVITY INFORMATION**CONDITIONS CONTRIBUTING TO INSTABILITY**

- Presence of incompatible materials.
- Product is considered stable.

ARDEX STS8Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet

Revision No: 3

Chemwatch 4963-56

Issue Date: 30-May-2008

CD 2008/2

- Hazardous polymerisation will not occur.

Section 11 - TOXICOLOGICAL INFORMATION**POTENTIAL HEALTH EFFECTS****ACUTE HEALTH EFFECTS****SWALLOWED**

The material can produce chemical burns within the oral cavity and gastrointestinal tract following ingestion.

The material has NOT been classified by EC Directives or other classification systems as "harmful by ingestion". This is because of the lack of corroborating animal or human evidence. The material may still be damaging to the health of the individual, following ingestion, especially where pre-existing organ (eg. liver, kidney) damage is evident. Present definitions of harmful or toxic substances are generally based on doses producing mortality rather than those producing morbidity (disease, ill-health). Gastrointestinal tract discomfort may produce nausea and vomiting. In an occupational setting however, ingestion of insignificant quantities is not thought to be cause for concern.

EYE

The material can produce chemical burns to the eye following direct contact. Vapours or mists may be extremely irritating.

If applied to the eyes, this material causes severe eye damage.

SKIN

The material can produce chemical burns following direct contact with the skin.

Solution of material in moisture on the skin, or perspiration, may increase irritant effects.

Handling wet cement can cause dermatitis. Cement when wet is quite alkaline and this alkali action on the skin contributes strongly to cement contact dermatitis since it may cause drying and defatting of the skin which is followed by hardening, cracking, lesions developing, possible infections of lesions and penetration by soluble salts.

Entry into the blood-stream, through, for example, cuts, abrasions or lesions, may produce systemic injury with harmful effects. Examine the skin prior to the use of the material and ensure that any external damage is suitably protected.

INHALED

Inhalation of dusts, generated by the material during the course of normal handling, may be damaging to the health of the individual.

The material can cause respiratory irritation in some persons. The body's response to such irritation can cause further lung damage.

Effects on lungs are significantly enhanced in the presence of respirable particles.

CHRONIC HEALTH EFFECTS

Principal routes of exposure are by accidental skin and eye contact and inhalation of generated dusts.

Cement contact dermatitis (CCD) may occur when contact shows an allergic response, which may progress to sensitisation. Sensitisation is due to soluble chromates (chromate compounds) present in trace amounts in some cements and cement products. Soluble chromates readily penetrate intact skin. Cement dermatitis can be characterised by fissures, eczematous rash, dystrophic nails, and dry skin; acute contact with highly alkaline mixtures may cause localised necrosis.

Repeated exposures, in an occupational setting, to high levels of fine- divided dusts may produce a condition known as pneumoconiosis which is the lodgement of any inhaled dusts in the lung irrespective of the effect. This is particularly true when a significant number of particles less than 0.5 microns (1/50,000 inch), are present. Lung shadows are seen in the X-ray. Symptoms of pneumoconiosis may include a progressive dry cough, shortness of breath on exertion, increased chest expansion, weakness and weight loss. As the disease progresses the cough produces a stringy mucous, vital capacity decreases further and shortness of breath becomes more severe. Pneumoconiosis is the accumulation of dusts in the lungs and the tissue reaction in its presence. It is further classified as being of noncollagenous or collagenous types. Noncollagenous pneumoconiosis, the benign form, is identified by minimal stromal reaction, consists mainly of reticulin fibres, an intact alveolar architecture and is potentially reversible.

There is some evidence that inhaling this product is more likely to cause a sensitisation reaction in some persons compared to the general population.

One ingredient of the product has caused skin sensitisation reactions, shown as localised reddening and hives, or may produce respiratory sensitisation characterised by asthma-like symptoms and runny nose.

TOXICITY AND IRRITATION

None assigned. Refer to individual constituents.

PORTLAND CEMENT:

unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.

Asthma-like symptoms may continue for months or even years after exposure to the material ceases. This may be due to a non-allergenic condition known as reactive airways dysfunction syndrome (RADS) which can occur following exposure to high levels of highly irritating compound. Key criteria for the diagnosis of RADS include the absence of preceding respiratory disease, in a non-atopic individual, with abrupt onset of persistent asthma-like symptoms within minutes to hours of a documented exposure to the irritant. A reversible airflow pattern, on spirometry, with the presence of moderate to severe bronchial hyperreactivity on methacholine challenge testing and the lack of minimal lymphocytic inflammation, without eosinophilia, have also been included in the criteria for diagnosis of RADS. RADS (or asthma) following an irritating inhalation is an infrequent disorder with rates related to the concentration of and duration of exposure to the irritating substance. Industrial bronchitis, on the other hand, is a disorder that occurs as result of exposure due to high concentrations of irritating substance (often particulate in nature) and is completely reversible after exposure ceases. The disorder is characterised by dyspnea, cough and mucus production.

SILICA CRYSTALLINE - QUARTZ:

unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.

TOXICITY

Inhalation (human) LCLo: 0.3 mg/m³/10Y

Inhalation (human) TCLo: 16 mppcf*/8H/17.9Y

Inhalation (rat) TCLo: 50 mg/m³/6H/71W

IRRITATION

Nil Reported

WARNING: For inhalation exposure ONLY: This substance has been classified by the IARC as Group 1: CARCINOGENIC TO HUMANS.

Intermittent; focal fibrosis,

(pneumoconiosis), cough, dyspnoea

Intermittent; liver - tumours.

ARDEX STS8**Hazard Alert Code:
HIGH**

Chemwatch Material Safety Data Sheet

Revision No: 3

Chemwatch 4963-56

Issue Date: 30-May-2008

CD 2008/2

* Millions of particles per cubic foot (based on impinger samples counted by light field techniques).

NOTE : the physical nature of quartz in the product determines whether it is likely to present a chronic health problem. To be a hazard the material must enter the breathing zone as respirable particles.

MATERIAL	CARCINOGEN	REPROTOXIN	SENSITISER	SKIN
----------	------------	------------	------------	------

silica crystalline - quartz

IARC:1

CARCINOGEN

IARC: International Agency for Research on Cancer (IARC) Carcinogens: silica crystalline - quartz Category: WARNING: This substance has been classified by the IARC as Group 1: CARCINOGENIC TO HUMANS.

Section 12 - ECOLOGICAL INFORMATION

DO NOT discharge into sewer or waterways.

Refer to data for ingredients, which follows:

PORTLAND CEMENT:

DO NOT discharge into sewer or waterways.

SILICA CRYSTALLINE - QUARTZ:

DO NOT discharge into sewer or waterways.

Section 13 - DISPOSAL CONSIDERATIONS

- Recycle wherever possible.
- Consult manufacturer for recycling options or consult local or regional waste management authority for disposal if no suitable treatment or disposal facility can be identified.
- Dispose of by: Burial in a licenced land-fill or Incineration in a licenced apparatus (after admixture with suitable combustible material)
- Decontaminate empty containers. Observe all label safeguards until containers are cleaned and destroyed.

Section 14 - TRANSPORTATION INFORMATION

Labels Required:

HAZCHEM: None

NOT REGULATED FOR TRANSPORT OF DANGEROUS GOODS:UN, IATA, IMDG

Section 15 - REGULATORY INFORMATION**POISONS SCHEDULE**

None

REGULATIONS

Ardex STS8 (CAS: None):

No regulations applicable

portland cement (CAS: 65997- 15- 1) is found on the following regulatory lists;

Australia Exposure Standards

Australia High Volume Industrial Chemical List (HVICL)

Australia Inventory of Chemical Substances (AICS)

OECD Representative List of High Production Volume (HPV) Chemicals

silica crystalline - quartz (CAS: 14808- 60- 7) is found on the following regulatory lists;

Australia - New South Wales Hazardous Substances Prohibited for Specific Uses

Australia - New South Wales Hazardous Substances Requiring Health Surveillance

Australia - South Australia Hazardous Substances Requiring Health Surveillance

Australia - Tasmania Hazardous Substances Prohibited for Specified Uses

Australia - Tasmania Hazardous Substances Requiring Health Surveillance

Australia - Western Australia Hazardous Substances Requiring Health Surveillance

Australia Exposure Standards

Australia Hazardous Substances

Australia Hazardous Substances Requiring Health Surveillance

Australia High Volume Industrial Chemical List (HVICL)

Australia Inventory of Chemical Substances (AICS)

Australia Occupational Health and Safety (Commonwealth Employment) (National Standards) Regulations 1994 - Hazardous Substances Requiring Health Surveillance

Australia Standard for the Uniform Scheduling of Drugs and Poisons (SUSDP) - Schedule 6

International Agency for Research on Cancer (IARC) Carcinogens

OECD Representative List of High Production Volume (HPV) Chemicals

No data available for silica crystalline - quartz as CAS: 122304- 48- 7, CAS: 122304- 49- 8, CAS: 12425- 26- 2, CAS: 1317- 79- 9, CAS: 70594- 95- 5, CAS: 87347- 84- 0.

Section 16 - OTHER INFORMATION**Ingredients with multiple CAS Nos**

ARDEX STS8**Hazard Alert Code:
HIGH**

Chemwatch Material Safety Data Sheet

Revision No: 3

Chemwatch 4963-56

Issue Date: 30-May-2008

CD 2008/2

Ingredient Name CAS

silica crystalline - quartz 14808-60-7, 122304-48-7, 122304-49-8, 12425-26-2, 1317-79-9, 70594-95-5, 87347-84-0

Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using available literature references.

A list of reference resources used to assist the committee may be found at:

www.chemwatch.net/references.

The (M)SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings. Risks may be determined by reference to Exposures Scenarios. Scale of use, frequency of use and current or available engineering controls must be considered.

This document is copyright. Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without written permission from CHEMWATCH. TEL (+61 3) 9572 4700.

Issue Date: 30-May-2008

Print Date: 12-Aug-2008